

Distributor Update
Tech Tips No. 7, 4/85



Error Correction on Fujitsu 2351/6122/Stand-Among DFMTR

Configuration: The Fujitsu Eagle M2351 with Zetaco SMD disk controllers configured for DG emulation 6122 under AOS or AOS/VS.

Problem: On Stand-Among DFMTR, 6122 only, (but NOT on Stand-Alone DFMTR), the sizing on initial power-up is incorrectly displayed as 6061 instead of 6122. This problem occurs with controllers that have the following assembly revision numbers or lower*:

BMX-1: 500400-000C
DC-295C: 500383-000E
DC-296C: 500284-000E
ZDF-1: 500294-000F

Assembly revision numbers are marked on the board next to the serial number.

Solution: The error, indicated by "Illegal Filename Character," can be corrected by re-running DFMTR Stand-Among (do not power down or I/O reset), or by running DFMTR Stand-Alone.

* On controllers with the following assembly revision numbers or higher, the problem will not occur:

BMX-1: 500400-000D
DC-295C: 500383-000F
DC-296C: 500284-000F
ZDF-1: 500294-000G

Units with these revision numbers will begin shipping after April 30.